


SPECIALITY UNIVERSAL JOINTS

Replacement U-Joints for Staked-In Style Driveshafts

Listed by Applications to Part Number

BMW			Nissan		
1989-93	BMW 535i	430-11	1978-84	Nissan 200SX	430-10
1987-92	BMW 735i	430-11	1989-93	Nissan 240SX	430-10
1993-94	BMW 740i	430-12A	1978-84	Nissan 280ZX	430-10
1993-94	BMW 740iL	430-12A	1990-96	Nissan 300ZX (Exc. Twin Turbo)	430-12
1988-94	BMW 750i	430-11	1990-96	Nissan 300ZX (Twin Turbo)	430-12A
1991-94	BMW M5	430-11	1984-89	Nissan 300ZX	430-11A
Datsun			1977-80	Nissan 810	430-10
1971-73	Datsun 1200	430-9	1977-80	Nissan Maxima	430-10
1974-78	Datsun B210	430-9	1986-89	Nissan Pickup D21	430-10
Diahatu			Subaru		
1990-92	Diahatu Rocky (Rear)	430-11	1986-89	Subaru 3 Door Coupe	430-10
Infinity			1985-89	Subaru Hatchback	430-10
1990-96	Infinity Q45	430-12A	1989-94	Subaru Justy	430-9
Jaguar			1990-91	Subaru Legacy	430-10
1988-89	Jaguar XJ6 - 3 Bolt Flange	430-10	1990-93	Subaru Loyale	430-10
Mazda			1985-89	Subaru Sedan	430-10
1992-95	Mazda 929	430-11	1992-96	Subaru SVX	430-10
1979-84	Mazda B2000	430-11	1985-89	Subaru Wagon	430-10
1986-89	Mazda B2000	430-11	1985-90	Subaru XT/XT6	430-10
1979-84	Mazda B2200	430-11	Toyota		
1987-89	Mazda B2200	430-11	1988-91	Toyota Camry All-Trac	430-10
1987-93	Mazda B2600	430-11	1981-85	Toyota Celica	430-10
1990-93	Mazda MPV (2WD)	430-11	1981-85	Toyota Corolla	430-10
1984-91	Mazda RX-7	430-10A	1989-92	Toyota Cressida	430-12
Merkur			1985-88	Toyota Cressida	430-10
1988-89	Merkur Scorpio	430-10B	1991-96	Toyota Previa	430-10
			1996-98	Toyota Rav 4	430-10

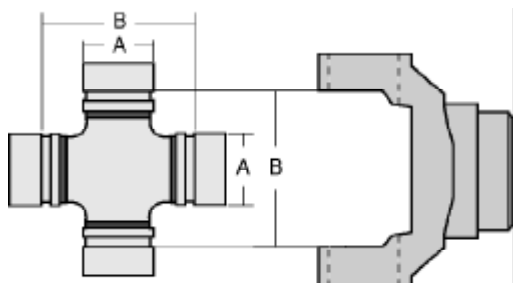

RDL Part No.	A Bearing Dia.	B Inside Lockup	Reference Notes
430-9	.791	1.285	Datsun, Subaru
430-10	.867	1.400	Jaguar, Nissan, Subaru, Toyota
430-10A	.867	1.515	Mazda
430-10B	.867	1.725	Merkur
430-11	.947	1.900	Diahatu, Mazda
430-11A	.947	1.641	Nissan
430-12	.972	1.641	Nissan, Toyota
430-12A	1.098	1.995	BMW, Infinity, Nissan

Rockford Drive Line

The Solution Company

1500 11th Ave
Rockford, IL 61104
Ph. 815-962-1411 - Fax 815-965-4857
www.rockforddriveline.com

Universal Joints - For "Staked In" Driveshafts

SPECIALITY UNIVERSAL JOINTS

Replacement U-Joints for Staked-In Style Driveshafts

Listed by Part Number to Applications

430-9

Datsun 1200	1971-73
Datsun B210	1974-78
Subaru Justy	1989-94

430-10

Jaguar XJ6-3 Bolt Flng	1988-89
Nissan 200SX	1978-84
Nissan 240SX	1989-93
Nissan 280ZX	1978-84
Nissan 810	1977-80
Nissan Maxima	1977-80
Nissan Pickup D21	1986-89
Subaru 3 Door Coupe	1986-89
Subaru Hatchback	1985-89
Subaru Legacy	1990-91
Subaru Loyale	1990-93
Subaru Sedan	1985-89
Subaru SVX	1992-96
Subaru Wagon	1985-89
Subaru XT/XT6	1985-90
Toyota Camry All-Trac	1988-91
Toyota Celica	1981-85
Toyota Corolla	1981-85
Toyota Cressida	1985-88
Toyota Previa	1991-96
Toyota Rav 4	1996-98

430-10A

Mazda RX-7	1984-91
------------	---------

430-10B

Merkur Scorpio	1988-89
----------------	---------

430-11

BMW 535i	1989-93
BMW 735i	1987-92
BMW 750i	1988-94
BMW M5	1991-94
Daihatsu Rocky (Rear)	1990-92
Mazda 929	1992-95
Mazda B2000	1979-84
Mazda B2000	1986-89
Mazda B2200	1979-84
Mazda B2200	1987-89
Mazda B2600	1987-93
Mazda MPV (2WD)	1990-93

430-11A

Nissan 300ZX	1984-89
--------------	---------


430-12

Nissan 300ZX (Exc. Twin Turbo)	1990-96
Toyota Cressida	1989-92

430-12A

BMW 740i	1993-94
BMW 740iL	1993-94
Infinity Q45	1990-96
Nissan 300ZX (Twin Turbo)	1990-96

RDL Part No.	A Bearing Dia.	B Inside Lockup	Reference Notes
430-9	.791	1.285	Datsun, Subaru
430-10	.867	1.400	Jaguar, Nissan, Subaru, Toyota
430-10A	.867	1.515	Mazda
430-10B	.867	1.725	Merkur
430-11	.947	1.900	Daihatsu, Mazda
430-11A	.947	1.641	Nissan
430-12	.972	1.641	Nissan, Toyota
430-12A	1.098	1.995	BMW, Infinity, Nissan

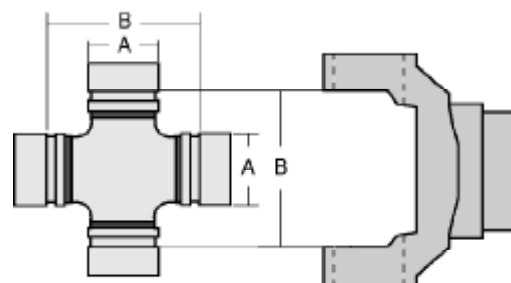

Rockford Drive Line

The Solution Company

1500 11th Ave

Rockford, IL 61104

Ph. 815-962-1411 - Fax 815-965-4857

www.rockforddriveline.com